

Development Services Center 178 Sams Street Decatur, GA 30030 www.dekalbcountyga.gov/planning 404-371-2155 (o); 404-371-4556 (f)

Chief Executive Officer
Michael Thurmond

# **DEPARTMENT OF PLANNING & SUSTAINABILITY**

Interim Director Cedric Hudson

## **Application for Certificate of Appropriateness**

Date submitted:	Г	ate Received:			
Address of Subject Property: 132	20 Harvard Roa	ad Atlanta	, GA 3030	06	
DD.				@priceresidentialde	sign.com
Applicant Mailing Address: 159	95 Nottingham	Way NE	Atlanta, GA	30309	
Applicant Phone: 404-245-4	244				
Applicant's relationship to the own		Architect	Contractor/Bu	Desi uilder Other	gner
Owner(s): Amy Birnbaun		******************* Email: _bi	rny.birny@	gmail.com	****
Owner(s): Adam Klein					
Owner(s) Mailing Address: 1320					
Owner(s) Telephone Number: 40	4-291-6911				
Approximate date of construction of Accessory Structu	ıre was iikeiy a	e on the property and the 1922 but	nd any other struct It before 19	tures affected by this projec	<sub>t:</sub> 1922_
Nature of work (check all that apply	y): New construction	New Acce	ssory Building	Other Building Chang	es 🗸
	Demolition	Landscapi	ng	Other Environmental	Changes
	Addition	Fence/Wa	11	Other	
Description of Work:	Moving a Building	Sign Insta	lation		
Renovate existing accessor porch will be removed and repaired that will require replaced with some slightly be replaced. Other than its main house.	replaced further to placing the existing modified in size o	rear on the sa g lap siding wit r location. Gar	me side. Mar h Hardiplank s rage door will l	ny structural deficienci siding. All windows ar be replaced. Fibergla	ies will be nd doors will be ass shingles will

This form must be completed in its entirety and be accompanied by supporting documents, such as plans, list of materials, color samples, photographs, etc. All documents should be in PDF format, except for photographs, which may be in JPEG format. Email the application and supporting material to <a href="mailto:plansustain@dekalbcountyga.gov">plansustain@dekalbcountyga.gov</a> and <a href="mailto:pvjennings@dekalbcountyga.gov">pvjennings@dekalbcountyga.gov</a>. An incomplete application will not be accepted.

Signature of Applicant: \_



#### DEPARTMENT OF PLANNING & SUSTAINABILITY

### Authorization of a Second Party to Apply for a Certificate of Appropriateness

This form is required if the individual making the request is not the owner of the property.

I/We: Amy Birnbaum and Adam Klein	
being owner(s) of the property at: 1320 Harvard Road	
hereby delegate authority to: David Price	

to file an application for a certificate of appropriateness in my/our behalf.

Signature of Owner(s):

Date: 3/22/25

#### Please review the following information

Approval of this Certificate of Appropriateness does not release the recipient from compliance with all other pertinent county, state, and federal regulations.

Before making any changes to your approved plans, contact the preservation planner (404/371- 2155). Some changes may fall within the scope of the existing approval, but others will require review by the preservation commission. If work is performed which is not in accordance with your certificate, a Stop Work Order may be issued.

If your project requires that the county issue a Certificate of Occupancy at the end of construction, an inspection may be made to verify that the work has been completed in accord with the Certificate of Appropriateness. If the work as completed is not the same as that approved in the Certificate of Appropriateness you will not receive a Certificate of Occupancy. You may also be subject to other penalties including fines and/or required demolition of the non-conforming work.

If you do not commence construction within twelve months of the date of approval, your Certificate of Appropriateness will become void and you will need to apply for a new certificate if you still intend to do the work.



1376 Church St., Ste 200, Decatur, GA 30030 Ph/Fax: 404-377-9316

February 16, 2018

RE: Structural Assessment for 1320 Harvard Road, Atlanta, GA 30306

Date of site visit: 02/12/18

Se#18063

The purpose of this letter is to provide a structural narrative and options for the proposed renovation of the standalone garage with carriage house above along with a covered porch on the side. The current construction consists of a concrete slab-on-grade, 8" brick foundation walls, 2x4 @ 20" stud wall with no sheathing. The floor framing over the garage consists of 2x12 @ 20" O.C., spanning 19'-6" "left-to-right", if facing the garage. An addition was added behind the garage with 2x8 @ 16" floor joists spanning 12'-0" "front-to-back". The roof framing we were able to see was 2x4 rafters and 1x roof sheathing. Overall, the garage is in poor condition with several major structural deficiencies. The brick foundation walls are cracked on several faces of the exterior wall which indicate settlement and movement. The wood walls have water and termite damage. The east wall is at risk of movement & settlement due to a failing retaining wall along the property line.

My understanding is that the building is being evaluated for the possibility of restoring the structure. The proposed plan would keep as much of the existing structure as possible and correct structural deficiencies. Any area of framing that is being repaired must be brought up to current code. Areas without known damage (such as the roof) do not need to be brought up to current code as long as they are not modified. Below is a narrative of the structural modifications required to complete this rehabilitation:

- 1. Rear "addition" foundation wall (approximately 12 feet long) at the north\east side needs to be replaced. A new footing at the rear corner is required, which will have to be excavated down approximately 3 feet to firm soil, or supported on a helical pier.
- 2. The floor joists over the garage are over-spanned and need to be stiffened by sistering new joists to the existing joists. New (2) 2x12 should be added to each existing joist to span the garage.
- 3. Rebuild exterior garage walls with 2x4 @ 16" with 7/16" OSB sheathing to replace existing wall with termite damage and no lateral bracing. This will require shoring support for the existing floor and walls above.
- 4. Provide new footings at front corners of garage. Add new portal frame with LVL header for lateral bracing per code.
- 5. Add approximately 4 concrete footings under "left" side brick foundation wall @ 48", cut in to slab and underpin wall.

Page - 2 -

Project: #-18063 – 1320 Harvard Road

2/16/2018

- 6. Add approximately 5 to 6 helical piers below brick stem wall @ 48" on "right" side of garage along eastern property line.
- 7. Add ±45 linear feet of new retaining wall, approximately 4 feet tall, along property line to replace existing failing granite wall.
- 8. Tear down and rebuild of side porch, which does not meet code as-is and has structural deficiencies. New framing to meet IRC 2012 GA deck amendments with appropriate connections to garage and diagonal bracing at columns.
- 9. Recommend re-pouring existing garage slab which is currently cracked, unlevel, and deteriorated.
- 10. The roof framing does not meet current code but can remain "grandfathered" if untouched. No damage observed.

It is our opinion that rehabilitation is possible with the structural corrections outline above; however the cost may be prohibitive and not financially feasible. If you have any questions, or if I can be of any assistance, please call me. Stability Engineering can provide full repair plans for permit if desired.

Sincerely, Stability Engineering, Inc.

Bob Englishent

Bob Englehart



Front garage wall. New footings and portal framed header required.



Left wall settlement crack, new underpinning footings required.



Left foundation wall and over-spanned 2x12 joists



Rear addition corner settlement to be re-built with new footing and wall

Page - 5 — Project: #-18063 — 1320 Harvard Road 2/16/2018



Addition side wall to be replaced





Damaged wall framing to be replaced


Page - 6 – Project: #-18063 – 1320 Harvard Road 2/16/2018



Side porch to be re-built

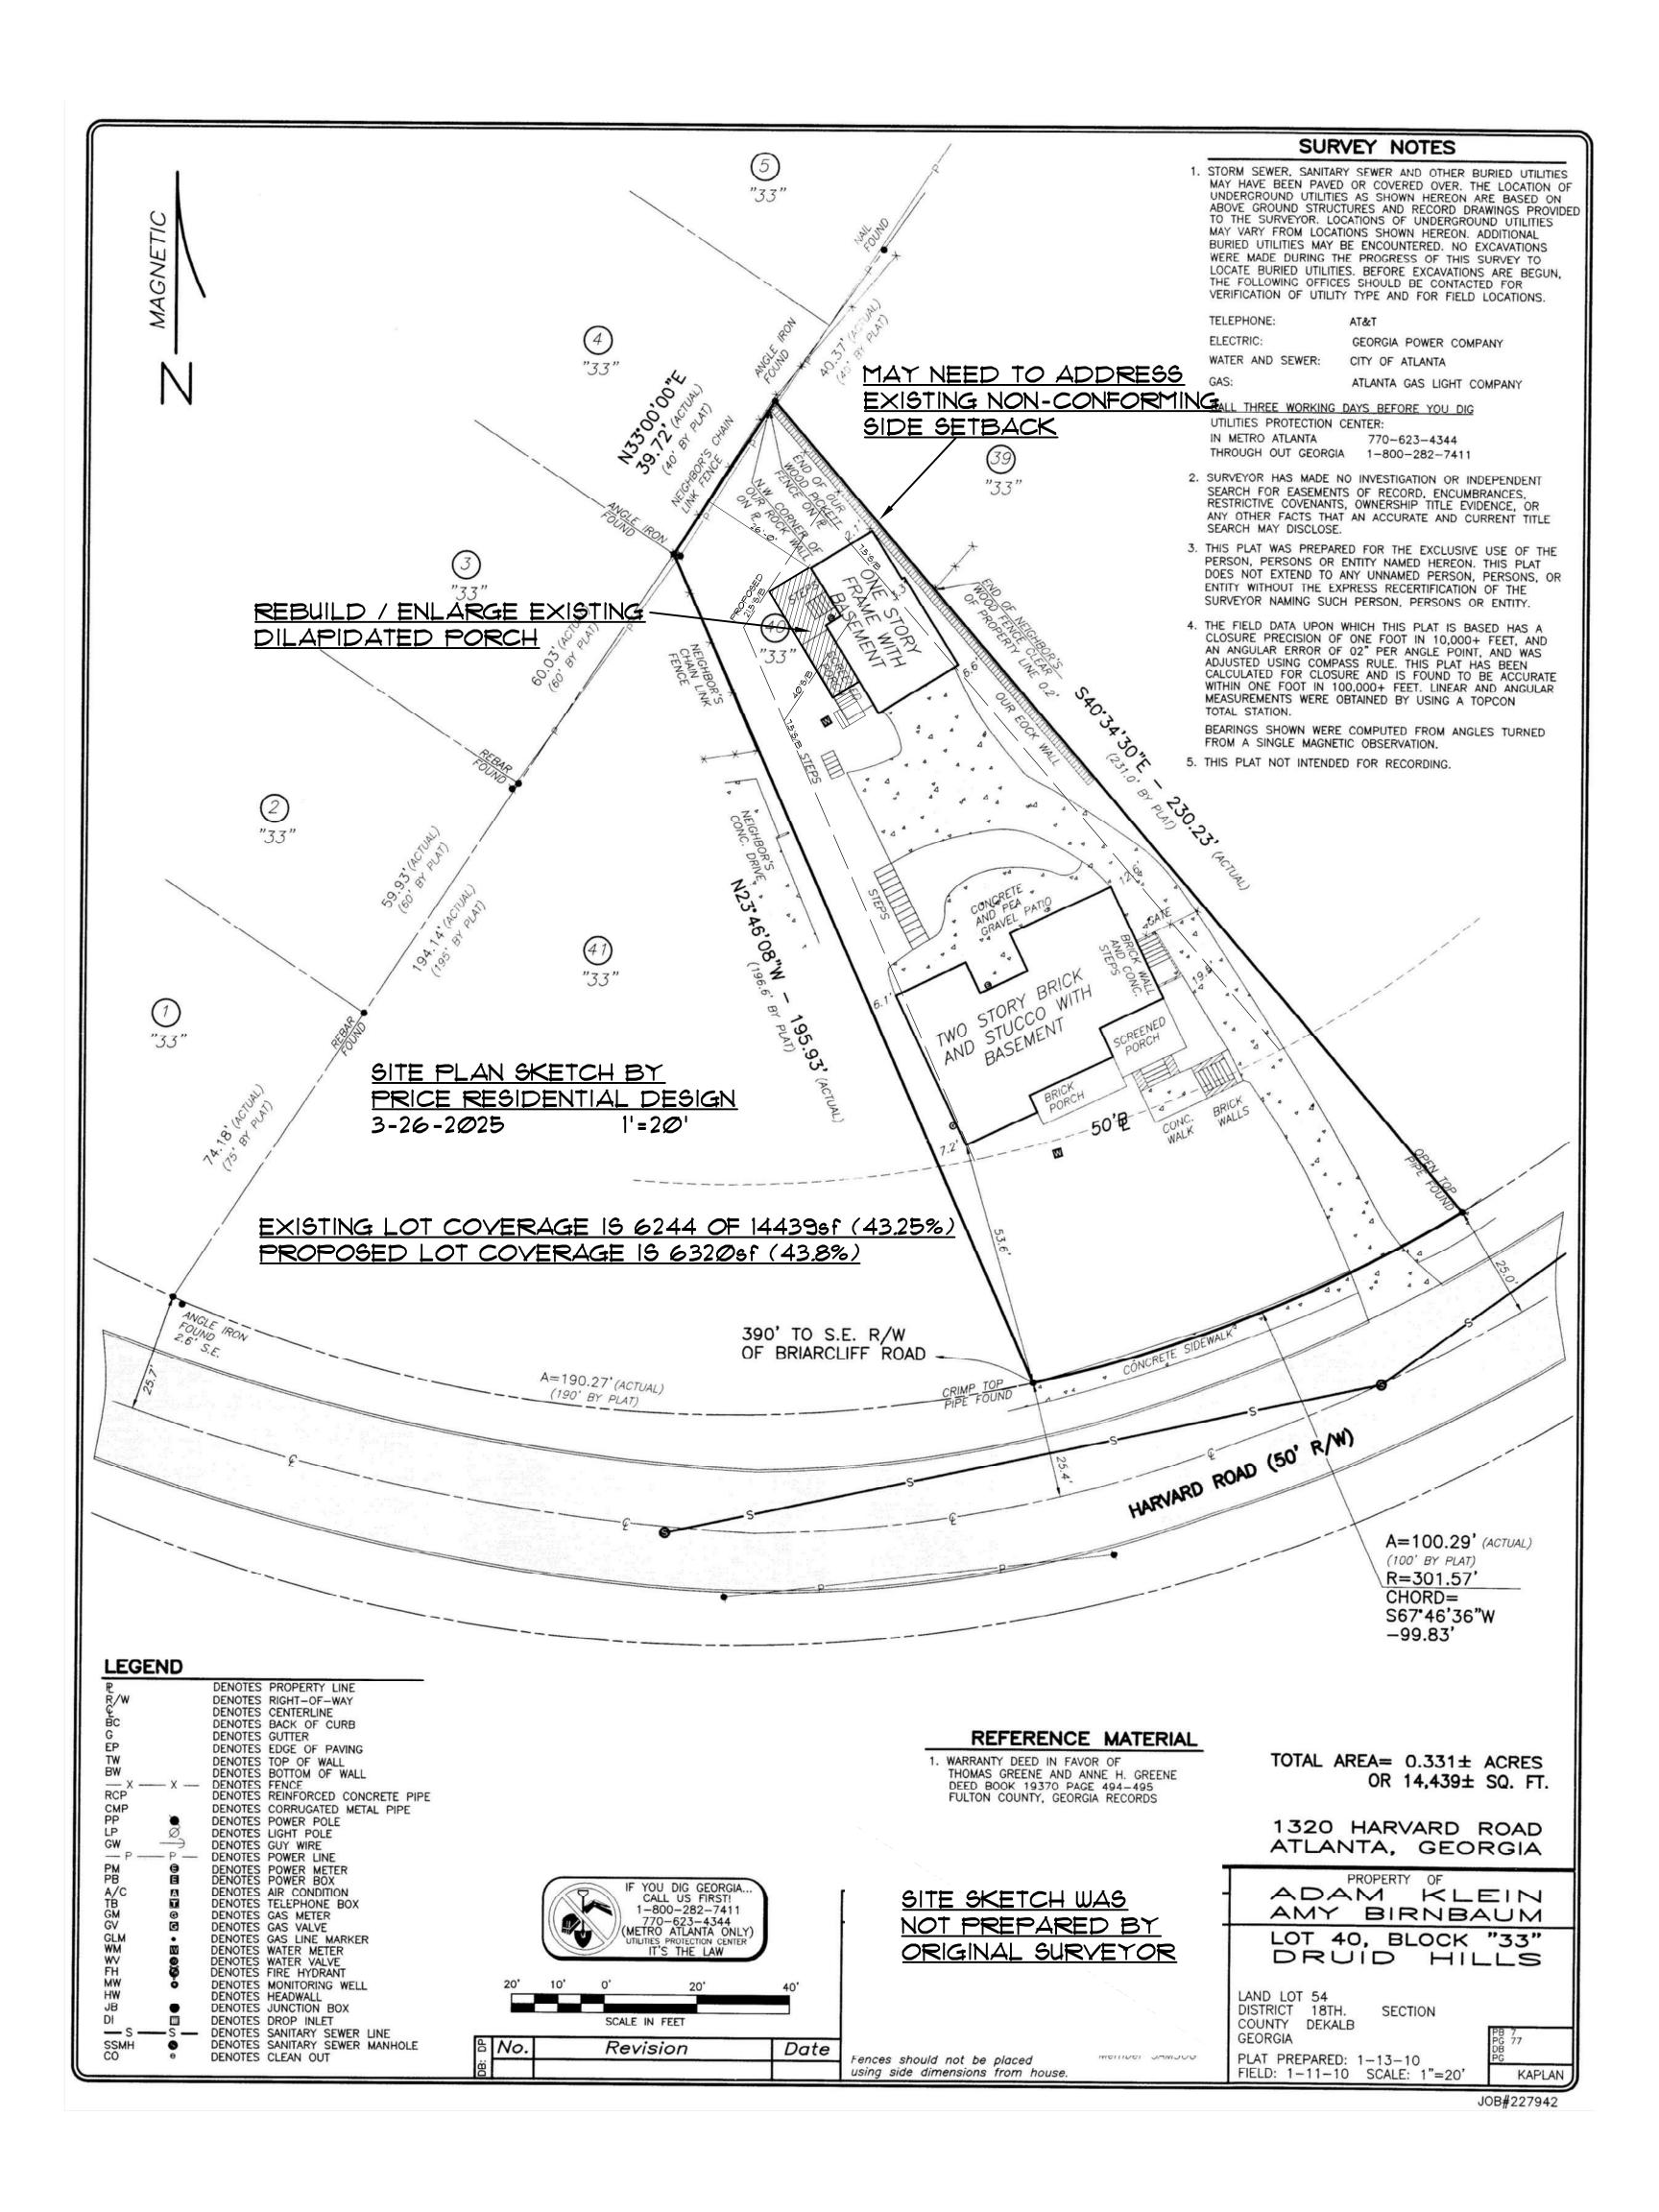

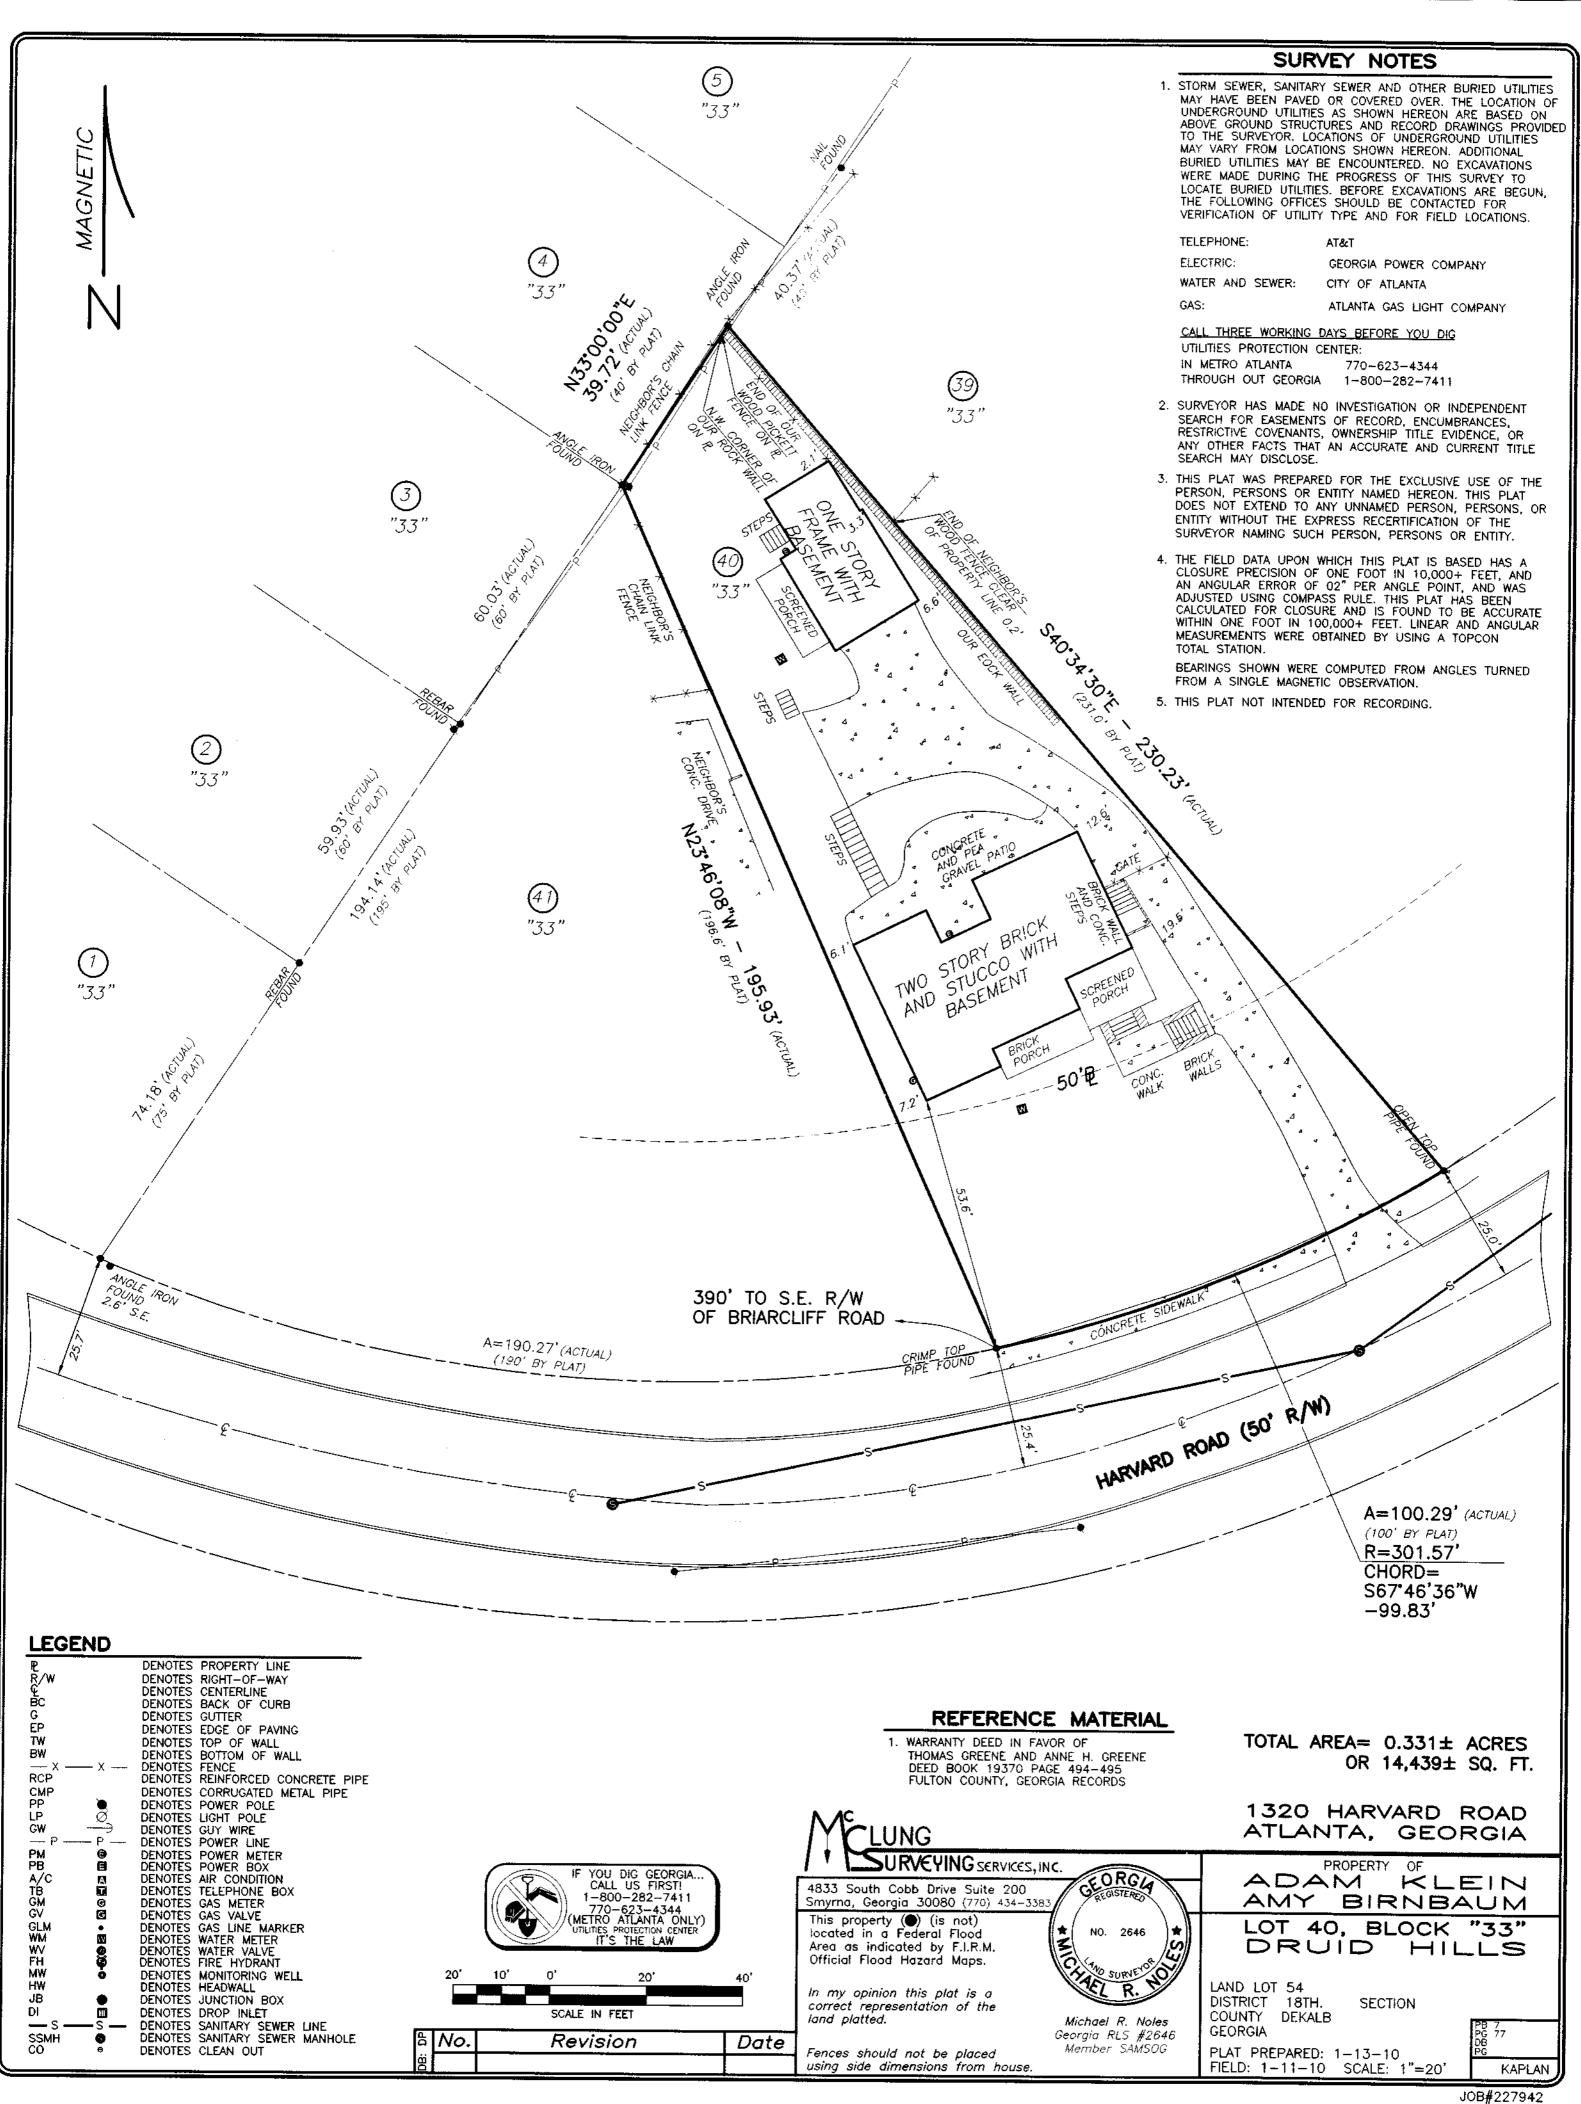

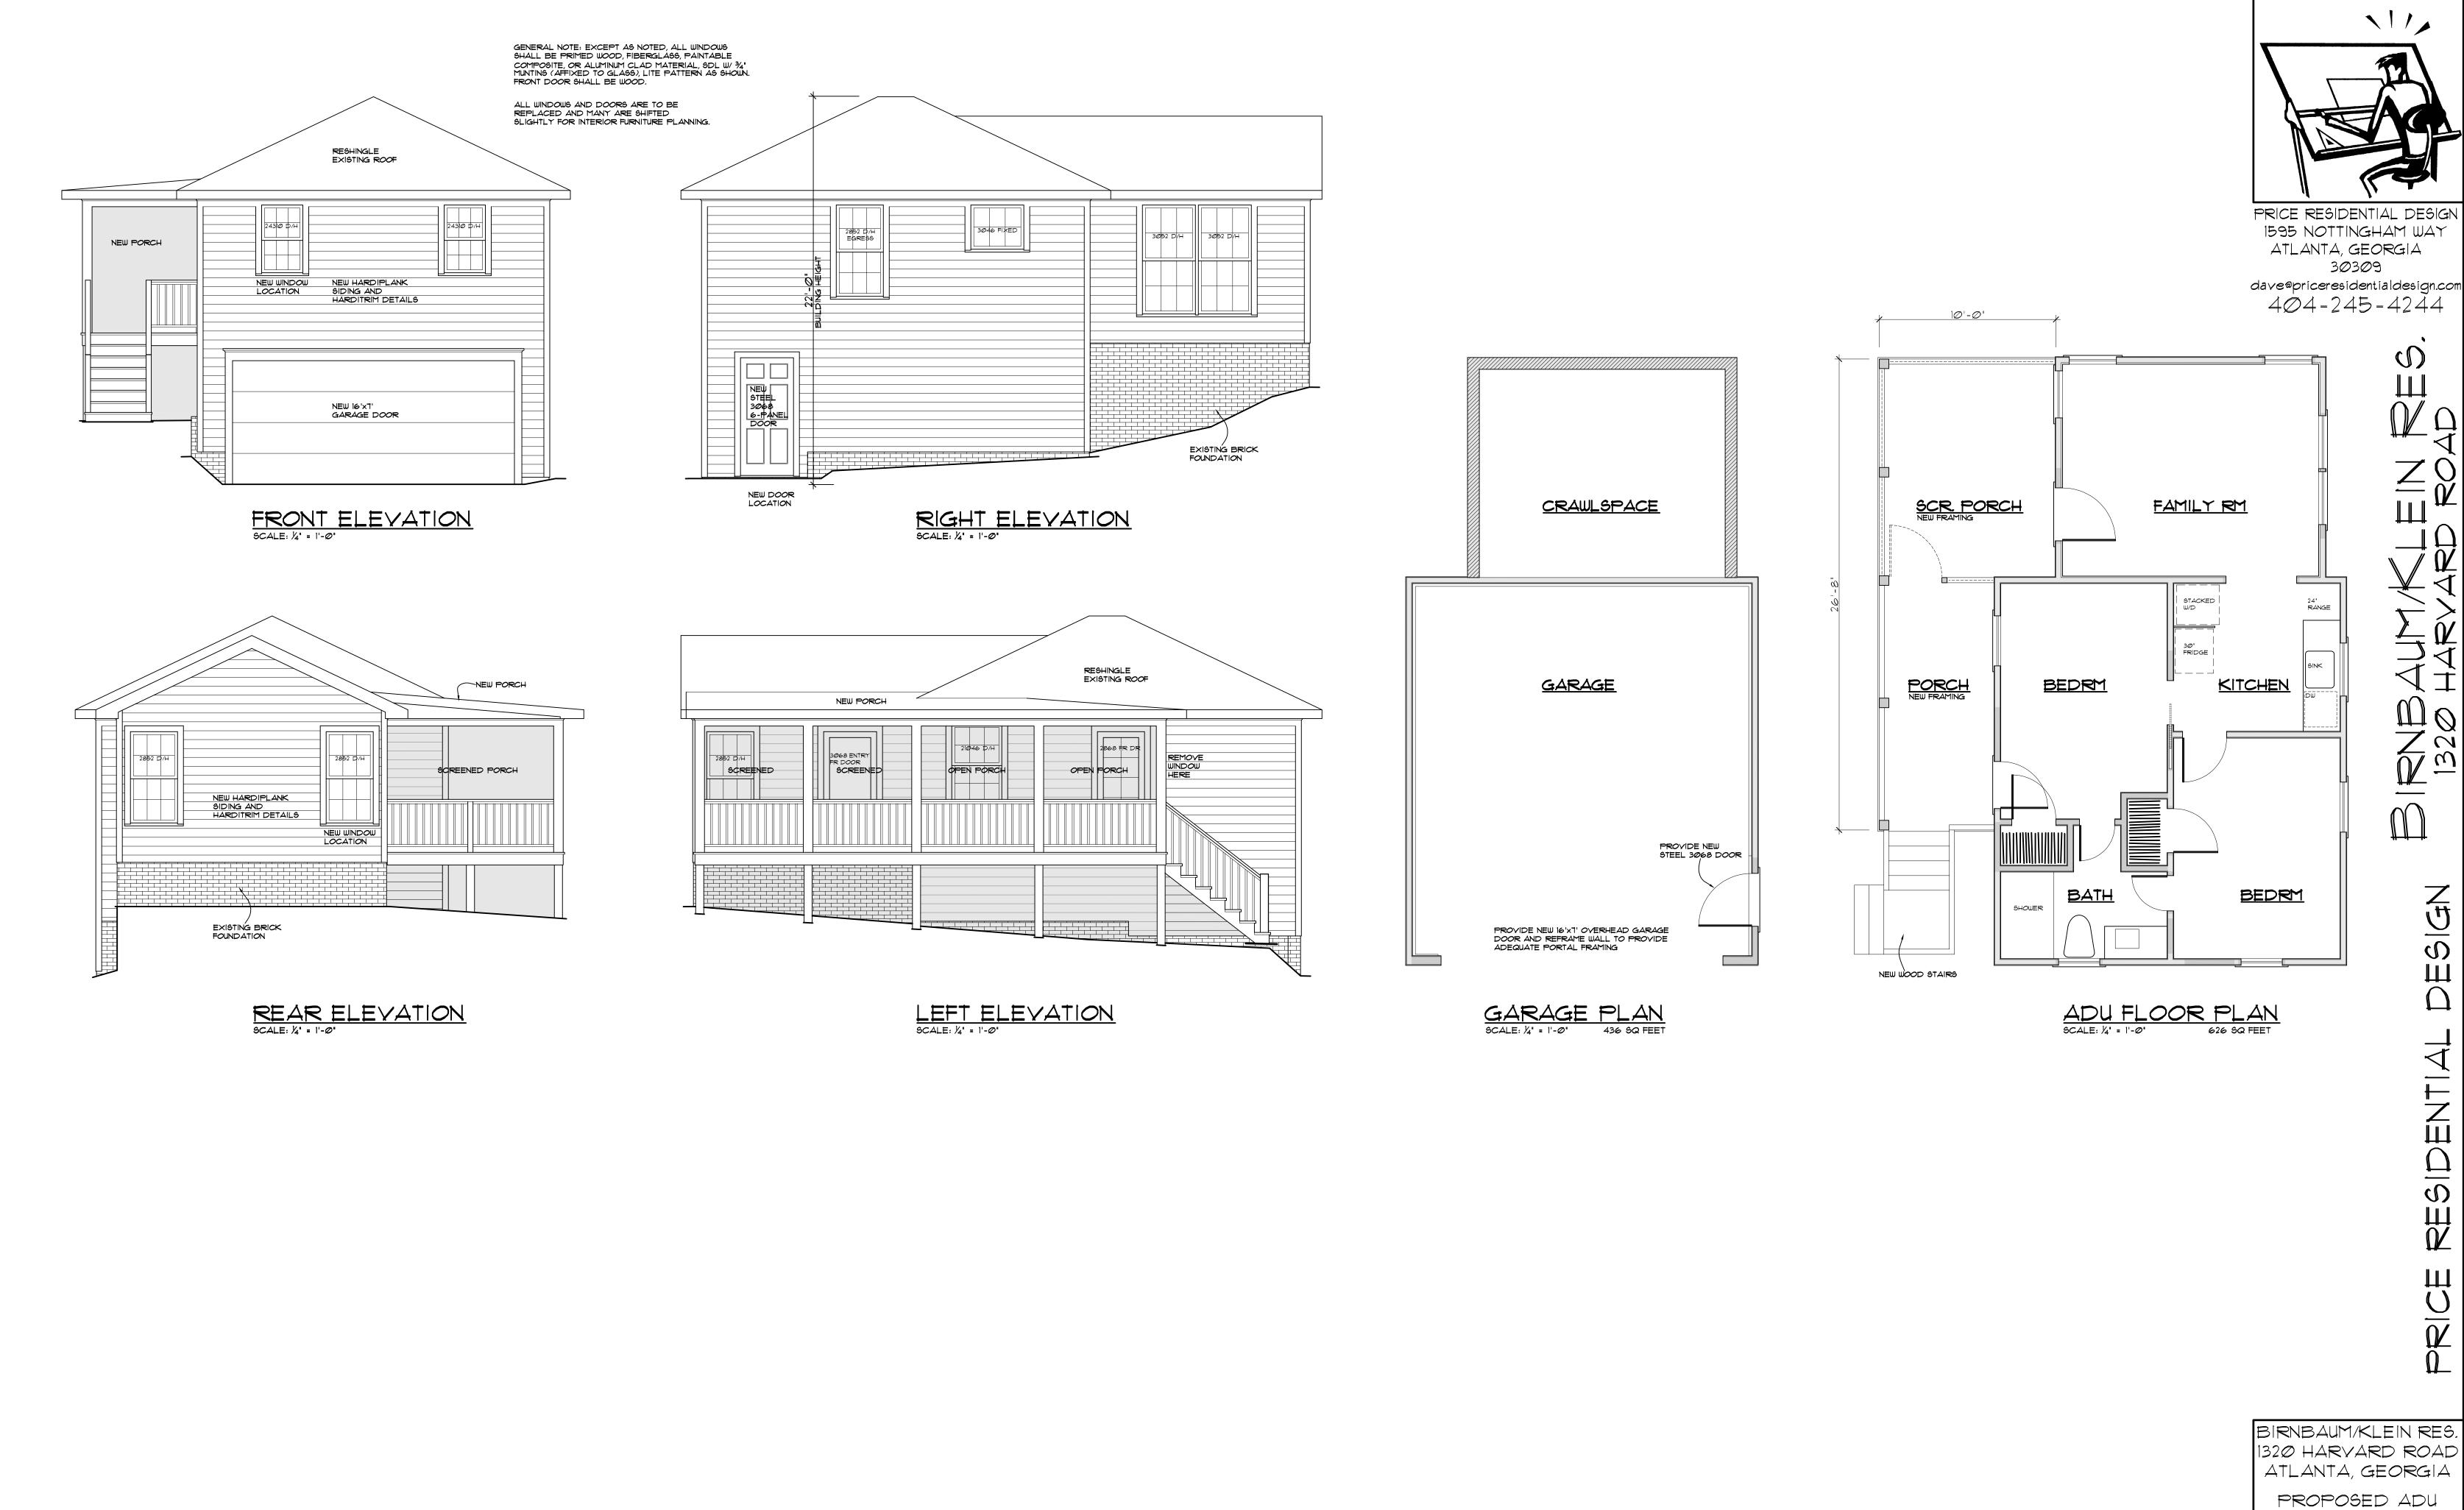

PROPOSED ADU Plans & Elevations

SHEET A-1

MARCH 26, 2025





BIRNBAUM/KLEIN RES. 1320 HARVARD ROAD ATLANTA, GEORGIA

EXISTING ADU PLANS & ELEVATIONS

MARCH 26, 2025

